

1 2 3 4

9.7 TM ASSY-S

A


B

C

D

E

F

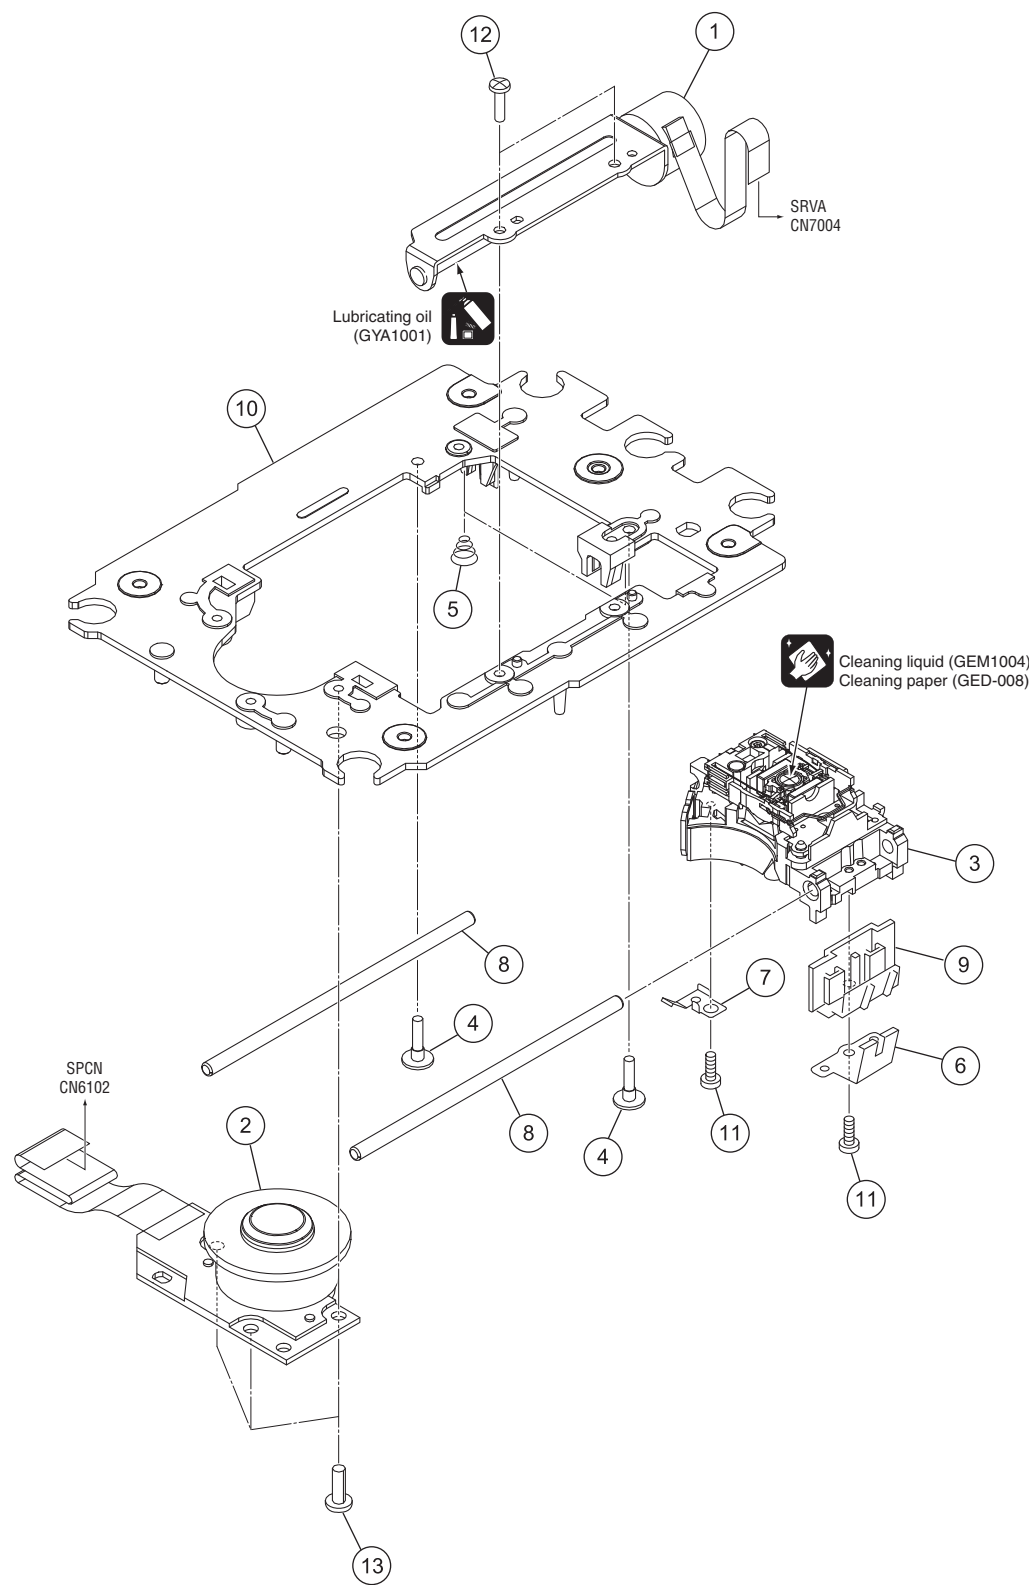

2. CONTRAST OF MISCELLANEOUS PARTS

NOTES: ● Parts marked by "NSP" are generally unavailable because they are not in our Master Spare Parts List.

● The  mark found on some component parts indicates the importance of the safety factor of the part. Therefore, when replacing, be sure to use parts of identical designation.

● Screws adjacent to ▼ mark on product are used for disassembly.

● For the applying amount of lubricants or glue, follow the instructions in this manual. (In the case of no amount instructions, apply as you think it appropriate.)

● Nos. indicate the pages and Nos. in the service manual for the base model.

● When ordering resistors, first convert resistance values into code form as shown in the following examples.

Ex.1 When there are 2 effective digits (any digit apart from 0), such as 560 ohm and 47k ohm (tolerance is shown by J=5%, and K=10%).

560Ω → 56 x 10¹ → 561 RD1/4PU    J

47kΩ → 47 x 10³ → 473 RD1/4PU    J

0.5Ω → R50 RN2HR   K

1Ω → 1R0 RS1P    K

Ex.2 When there are 3 effective digits (such as in high precision metal film resistors).

5.62kΩ → 562 x 10¹ → 5621 RN1/4PC     F

2.1 CONTRAST TABLE

(1) CDJ-2000 and CDJ-2000/2 are constructed the same except for the following:

Mark	No.	Symbol and Description	CDJ-2000 /CUXJ/SYXJ8/FLXJ/KXJ/AXJ5	CDJ-2000 /UXJCB2/SYXJ82/FLXJ2/KXJ2/AXJ52	Remarks
NSP		PCB ASSEMBLIES			
	P77-2	1..TFTA Assy	DWM2355	DWM2445	*2
	P83-1	2..SDCB Assy	DWX2980	DWX3293	*1
	P83-1	2..TFTB Assy	DWX2882	DWX3291	*1
	P83-2	2..CDCB Assy	DWX2987	DWX3292	
		DISPLAY SECTION			
	P83-3	LCD	DWX3126	CWX3970	
	P83-17	LCD Packing (Top)	DEC3193	DEC3376	
	P83-18	LCD Stay	DND1263	DND1267	
	P83-19	Rear Bracket	DND1264	DND1268	
	P83-20	LCD Holder	DNH2850	Not used	
	P83-21	LCD Panel	DNK5319	DNK5951	
	P83-30	Screw	BBZ30P060FTB(x 22)	BBZ30P060FTB(x 21)	
	P83-31	Screw	BSZ20P040FTB	Not used	
		Screw	Not used	BSZ30P040FTC	No. 1
		40P FFC	Not used	DDD1541	No. 2
		Fitting/LCD	Not used	DNH2992	No. 3

(2) CDJ-2000/CUXJ and CDJ-2000/UXJCB2 are constructed the same except for the following:

Mark	No.	Symbol and Description	CDJ-2000/CUXJ	CDJ-2000/UXJCB2	Remarks
		PACKING SECTION			
	P75-1	Power Cable	ADG7021	ADG7022	
	P75-23	Packing Case	DHG2800	DHG3025	

(3) CDJ-2000/SYXJ8 and CDJ-2000/SYXJ82 are constructed the same except for the following:

Mark	No.	Symbol and Description	CDJ-2000/SYXJ8	CDJ-2000/SYXJ82	Remarks
	P75-23	PACKING SECTION Packing Case	DHG2799	DHG3026	

(4) CDJ-2000/FLXJ and CDJ-2000/FLXJ2 are constructed the same except for the following:

Mark	No.	Symbol and Description	CDJ-2000/FLXJ	CDJ-2000/FLXJ2	Remarks
	P75-23	PACKING SECTION Packing Case	DHG2801	DHG3028	

(5) CDJ-2000/KXJ5 and CDJ-2000/KXJ52 are constructed the same except for the following:

Mark	No.	Symbol and Description	CDJ-2000/KXJ	CDJ-2000/KXJ2	Remarks
	P75-23	PACKING SECTION Packing Case	DHG2804	DHG3029	

(6) CDJ-2000/AXJ5 and CDJ-2000/AXJ52 are constructed the same except for the following:

Mark	No.	Symbol and Description	CDJ-2000/AXJ5	CDJ-2000/AXJ52	Remarks
	P75-23	PACKING SECTION Packing Case	DHG2803	DHG3030	

*1 Refer to "3.PCB PARTS LIST", "5.SCHEMATIC DIAGRAM" and "6.PCB CONNECTION DIAGRAM".

*2 Although DWX2980 and DWX3293 are different in part number, they are constructed same. Refer to "CDJ-2000/CUXJ(RRV3999)".

Changing the constants for the parts of the MAIN and JACB Assys

With a modification of the LCD section, the constants for the parts of the MAIN and JACB Assy, have been changed for improvement of the sound quality.

Mark	No.	Description	Part No.
MAIN Assy : DWG1660			
<u>RESISTORS</u>			
R	570	RS1/16SS332J =>	RS1/16SS222J
R	571	RS1/16SS332J =>	RS1/16SS222J
R	572	RS1/16SS332J =>	RS1/16SS222J
R	573	RS1/16SS332J =>	RS1/16SS222J
<u>CAPACITORS</u>			
C	3093	CEHVAW101M16 =>	CCH1565
JACB Assy : DWX2988			
<u>CAPACITORS</u>			
C	9401	CEHAZL220M50 =>	CEHAZL101M25
C	9404	CEHAZL220M50 =>	CEHAZL101M25